

Section 25 T09N-R02W Richland	Section 30 T09N-R01W Bloomington
Section 36 T09N-R02W Richland	Section 31 T09N-R01W Bloomington

WITNESS MONUMENT TIES			
ID	BEARING	DISTANCE	DESCRIPTION
Witness A	S 1d E	15.3'	Cut X found 2.4' above grade on the east side of a 1.0' x 1.3' x 5.6' tall limestone post marked "R/W" on the south side.
Witness B	S 71d W	51.6'	PK nail and flagging found 0.6' above grade on the northwest side of a 14" electric transmission pole
MONUMENT ACCESSORIES			
Other survey grade monuments that were located in the vicinity and their relation to the monument. Geodetic coordinates in this table are provided in the format Easting, Northing.			
(#10107)	N 0d37'25" W	39.61' (m) 39.6' (original falling)	3097237.52, 1432148.90 1" iron pin found flush in concrete in Vernal Pike at the Section Corner common to sections 30 & 31 -T9N-R1W (Blm_A21)
(#10117)	N 79d44'12" W	66.83'	3097172.19, 1432121.20 Cut X in the southwest back of curb inlet
(#10126)	N 80d25'3" E	89.41'	3097326.12, 1432124.18 Cut X in southwest back of curb inlet



OTHER ACCESSORIES:

Work done to preserve existing monument. A 5' steel t-post was set 0.5' north of the north face of a 5.6' tall limestone post on the south side of Vernal Pike. A Monroe County "PROTECT NEARBY SURVEY SIGN" was attached facing north 2.6' above grade.

NOTES:

- Field work was performed on 02/26/2019.
- Monroe County Surveyor's Field Book 53, page 35.
- Project Name: 2019-003_2019_INDOT_Network, Field work by: RSO & TER, Drawn by: RSO, Reviewed by: RSO, TER & SRB.
- The basis of bearings is Grid North NAD83(2011), Indiana West Zone, Epoch 2010.0000, Geoid Model G2012BU7, Datum NAD83_NO_TRANS, US Survey Feet, derived from GPS observations utilizing the Indiana Real-Time Network (INCORS). Distances obtained with GPS have not been adjusted to ground. Coordinate data was collected with a Javad Triumph LS Network Rover.
- Vicinity sketch was compiled per 2017 aerial photography.
- A rebar with cap stamped "RLS 890006" was set at this corner by Doug Curry in 1990 per an ALTA survey on file in the Monroe County Surveyor's Office as RSID002742. The Curry rebar was witnessed and accepted by Monroe County Surveyor Michael Friley on February 23, 1996. A standard INDOT section corner monument was set to replace the rebar after construction of Vernal Pike road improvements performed by the Monroe County Highway Department and INDOT. We collected coordinates on the new monument to perpetuate the accepted location of this corner. Historic research has not yet been performed to prove the validity of this monument.

▲ **Monument Description:** 1" iron pin found flush in concrete on the south side of Vernal Pike

State Plane Grid Coordinates: Point No.: 10096 Northing: 1432109.29', Easting: 3097237.95'

SHEET 1 OF 2	MONUMENT RECORD CORNER ID: Rich_Y21	Section Corner Section 25 & 36- T09N-R02W Richland Township Monroe County, Indiana	 OFFICE OF THE MONROE COUNTY SURVEYOR Trohn Enright-Randolph Monroe County Surveyor Rachel Savich Oser Professional Surveyor 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570
-----------------------	---	--	--

Photos were taken on 02/26/2019 with an iPhone 6s



Trohn Enright-Randolph
Trohn Enright-Randolph
Monroe County Surveyor

Accepted by the Monroe
County Surveyor Review Board
on 07/02/2019

Rachel Oser
Rachel Savich Oser, State of Indiana
Professional Surveyor No. 21100022

SHEET
2
OF
2

MONUMENT RECORD
CORNER ID:
Rich_Y21

Section Corner
Section 25 & 36- T09N-R02W
Richland Township
Monroe County, Indiana



OFFICE OF THE MONROE COUNTY SURVEYOR
Trohn Enright-Randolph *Monroe County Surveyor*
Rachel Savich Oser *Professional Surveyor*
119 West 7th Street, Bloomington, IN 47404 (812) 349-2570

MONUMENT RECORD


Corner I.D. #

Y-21

STATE OF INDIANA - COUNTY OF MONROE

Section Thirty-six, 36, Township 9 North, Range 2 West

Monument Description & Remarks: Found 5/8" Rebar w/plastic cap "R.L.S. 890006" at NE corner of section. Rebar was flush w/ground. County survey marker sign set S 09° W, 7.43' on wood fence post (5" diameter), see below.

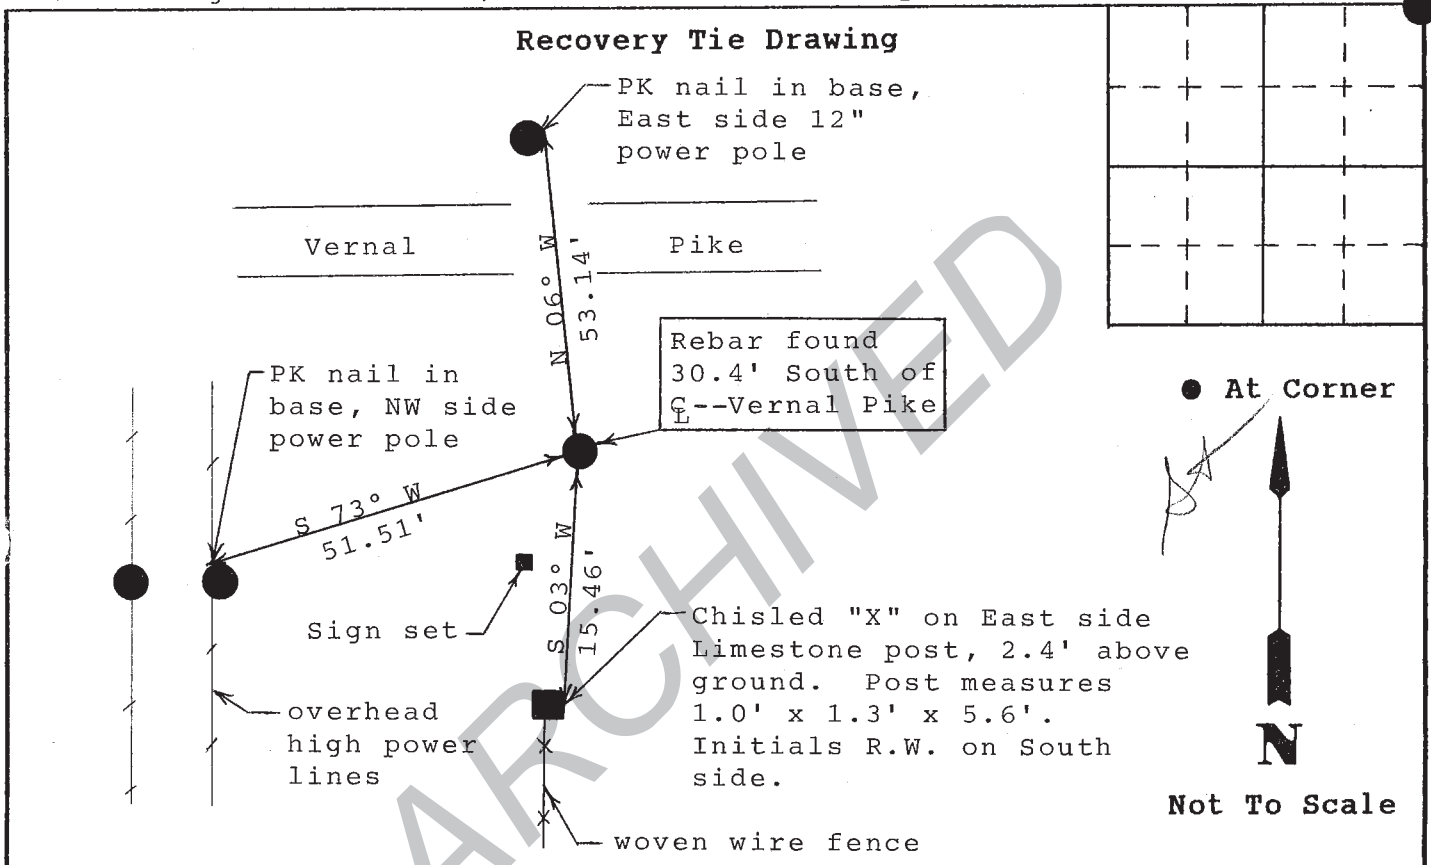

State of Indiana
County of Monroe

Space
Reserved For
Recording
Officer

I, Michael W. Friley, County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 17-3-64-4 through 17-3-64-8 of the Indiana Code, being Acts of 1965, Chapter 319; and the above data is given under my hand and seal this 23rd day of February, 1996 A.D.

Indiana Registered Land Surveyor No. _____ or

Monroe County Surveyor's Office
United States Government Agency

Monroe County Surveyor
Title

Field Book:

96-01

Page:

26